
ABZ Number: 58300000164288 Service Part Information Part: EN Version: Washers Date: March 14, 2017 Page: 1/1

00436440, 00674704, 00703146

The information provided in this document is intended for trained, qualified personnel only. The proper function and the safety of the appliance can be affected by an improper repair, and even serious threats to life or physical condition may arise. BSH Home Appliances Corporation is not liable for damages caused by improper repairs performed by unauthorized parties. Local codes and standards apply and must be observed. Authorized Servicers may contact the Technical Support Team for further assistance.

EN Replacing 00436440 Nexxt and 00674704 / 00703146 Vision drain pumps

Due to a vendor change, 00436440 Nexxt drain pumps are provided differently. Original housings aren't available, replaced by newer housings with <u>open</u> manual drain hose ports, instead of plugged (see drawing below for port location). To avoid leaking, replacement 00436440 drain pumps come assembled with manual drain hoses (with hose clamps and plugs) since production washers didn't include hoses. Hoses must be stowed near drain pumps when installed.

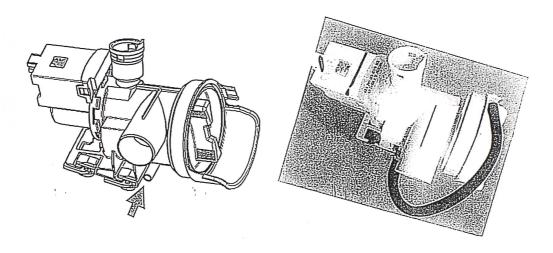

To avoid leaking on WFMC/WFXD Nexxt washers, do not remove hoses, hose clamps or plugs from pumps.

00703146 drain pumps are no longer available and are replaced by 00436440 drain pumps. Drain hoses provided with 00436440 drain pumps are <u>too short</u> (for WFVC UC/26 and up 4-shock Vision washers) and <u>must</u> be replaced with existing washer drain hoses.

Hoses are the same as supplied with WFVC UC/19 - UC/25 Vision washers, so 00436440 drain pumps can replace 00674704 drain pumps as is.

For authorized servicers, additional assistance is available by contacting our Technical Support team at (800) 444-9091 or by visiting our Quickfinder website at http://portal.mch.bsbq.com/servicers